DART SERVICE BULLETIN SB12-2

AFFECTING:


D407-797-011/-012/-013/-014 AND D206-797-021/-022/-023/-024 HELI-UTILITY-BASKET INSTALLATIONS AT CHANGE 003 OR EARLIER

REF TCCA STC: SH11-1 FAA STC: SR02996NY REF EASA STC: 10035429

Dart Aerospace Ltd. has received information indicating that under certain circumstances on D407-797-011/-012/-013/-014 and D206-797-021/-022/-023/-024 Heli-Utility-Basket Installations at CHANGE 003 or earlier, thin flexible objects such as an unsecured retaining strap can find their way out of the basket through the narrow opening located along the top inboard side of the basket base assembly, and cause damage to the aircraft and/or depart from the basket in flight.

For operators with aircraft equipped with D407-797-011/-012/-013/-014 and D206-797-021/-022/-023/-024
Heli-Utility-Basket Installations at CHANGE 003 or earlier, it is recommended that the opening described above be closed off with D4672-1 Blanking Plates using the DSI 9620-011 Blanking Plate Kit per DSI 9620 Rev. A (or later approved revision).

Dart Aerospace Ltd. regrets any inconvenience this may cause.

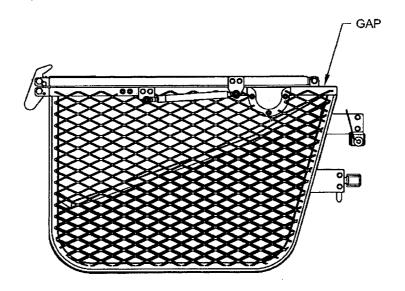

Α	NEW ISSU			МВ	12.06.25
REV.			DESCRIPTION	BY	DATE
DESIGN		国	DART AEROSPACE LTD		
DRAWN		h	HAWKESBURY, ONTARIO, CANADA		
CHECKE	D	(M)	DRAWING NO.		REV. A
MFG. AF	PPR.	V/An	SB12-2	5	SHEET 1 OF 1
APPRO\	/ED	111	TITLE		SCALE
DE APP	₹.	##-	HELI-UTILITY-BASKET		NTS
DATE-	12.06.2	25	COPYRIGHT © 2012 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WITHOUT WITHOUT WITHOUT AND ARROSPACE IT ARROSPACE IT.		